

YEAR 20____ DATE	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
------------------------	---------------------------	-------------------	-----------------------------	---

Aircraft Service And Parts, L.L.C.
3501 North Airport Road
Williams, Arizona 86046
928-642-8643 602-430-4397


Date: 10-15-2020
Tach Time: 4519.30
Total Time: 4519.30
Time SMOH: 1185.00

Complied with recurring A.D. #s 81-23-03 R2 by inspection IAW paragraph B) 1. and 2. and 11-10-09 by inspection IAW paragraph (g) (1) through (10). All other airframe and airframe accessory A.D.s through 2021-21 n/a or pcw. See A.D. compliance record for details.

Tested E.L.T. IAW FAR 91.207 paragraph (d). New E.L.T. battery expires 9-22. Replaced instrument vacuum regulator filter, replaced instrument air central inlet filter, lubricated all push pull controls, lubricated all engine controls, replaced three eyebrow instrument light lamps, cleaned pressurization outflow valves, replaced pilot's seat back clevis pins, replaced nose wheel bearings and races, adjust flap cables, replaced left and right outboard fuel cap o-rings and tightened all rudder bar mounting bracket hardware.

I certify that this aircraft has been inspected IAW an annual inspection and was determined to be in an airworthy condition at this time.

Thomas L. Town 3648361IA

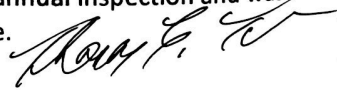

--	--	--	--	--

YEAR 20 _____ DATE	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations <small>Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)</small>
--------------------------	---------------------------	-------------------	-----------------------------	--

Aircraft Service And Parts, L.L.C.
3501 North Airport Road
Williams, Arizona 86046
928-642-8643 602-430-4397

Date: 10-15-2021
Tach Time: 4519.30
Total Time: 5693.90
Time SMOH: 1185.00

All engine and engine accessory A.D.s through 2021-21 n/a or pcw. See A.D. compliance record for details.

Compression check #1 66/80, #2 65/80, #3 66/80 #4 68/80 #5 68/80 and #6 68/80. Magneto timing is within limits. Cleaned and gapped all spark plugs. Replaced #2-cylinder top spark plug. Drained oil, replaced oil filter, opened and inspected removed oil filter, no contamination found. Serviced engine with 10 quarts of Aeroshell 100W oil. Removed oil cooler, resealed both oil cooler fittings and reinstalled oil cooler. Run up and leak check ok, all functions normal.

I certify that this engine has been inspected IAW a 100 hour/annual inspection and was determined to be in an airworthy condition at this time.

Thomas L. Town 36483611A



HUB & BLADE INSPECTIONS, REPAIRS AND ALTERATIONS

Year: _____

Date: _____

Next In
Due: _____

Aircraft Service And Parts, L.L.C.
3501 North Airport Road
Williams, Arizona 86046
928-642-8643 602-430-4397

Date: 10-15-2021

Tach Time: 4519.30

Total Time: 4519.30

Time SPOH: 605.00

Year: _____

Date: _____

Next In
Due: _____

All propeller and propeller accessory A.D.s through 2021-21 n/a or pcw. See
A.D. compliance record for details.


Inspected blades, hub and spinner assembly. Dressed and painted blades.

I certify that this propeller has been inspected IAW a 100 hour/annual
inspection and was determined to be in an airworthy condition at this time.

Year: _____

Date: _____

Thomas L. Town 3648361IA

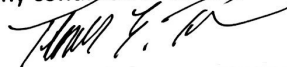

Next Inspection
Due: _____

Time Since
Overhaul _____

Mech. Cert. # or Repair Station # _____